


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-145	Smoke	11/18/2008	ADS/TM	S09QQ1031MH	Dry	Yes	1,111.81

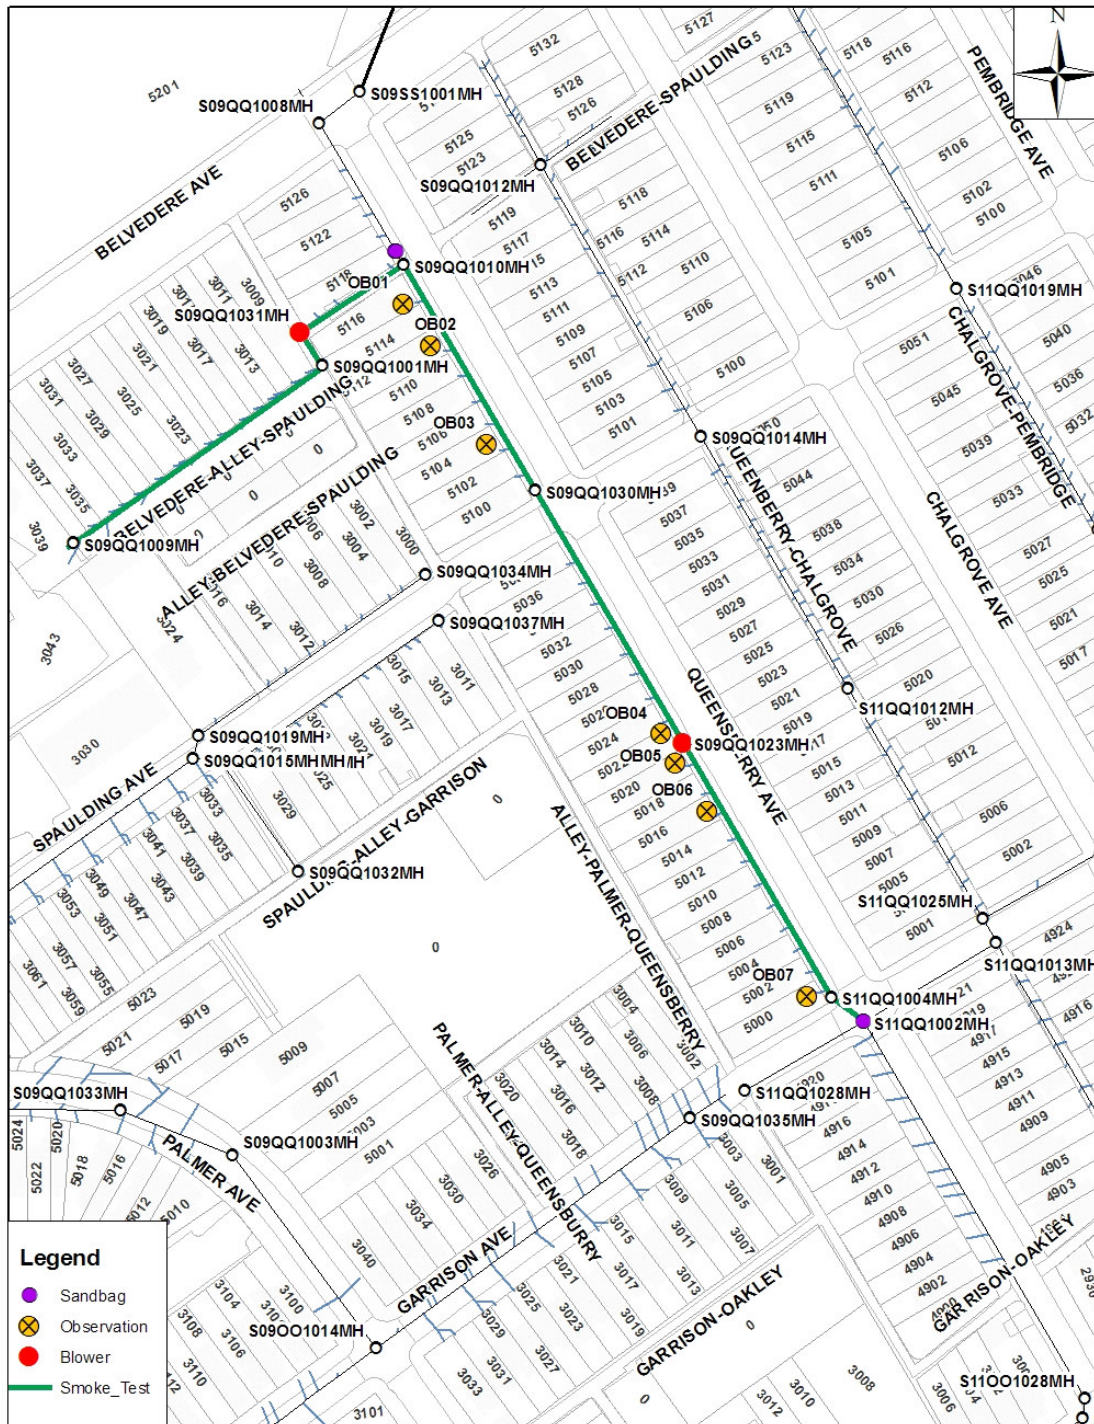

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-145	Smoke	11/18/2008	ADS/TM	S09QQ1031MH	Dry	Yes	1,111.81

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S09QQ1009G1	S09QQ1009MH	S09QQ1001MH	254.5444	8
S09QQ1001G1	S09QQ1001MH	S09QQ1031MH	33.33632	8
S09QQ1031G1	S09QQ1031MH	S09QQ1010MH	101.6485	8
S09QQ1010G1	S09QQ1010MH	S09QQ1030MH	213.9746	8
S09QQ1030G1	S09QQ1030MH	S09QQ1023MH	237.8195	8
S09QQ1023G1	S09QQ1023MH	S11QQ1004MH	239.2552	8
S11QQ1004G1	S11QQ1004MH	S11QQ1002MH	31.23071	8

Observations & Photos

Obs_ID S1028-145-OB01

Address 5116 Queensberry Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S09QQ1010MH

Comments Smoke from cleanout in front yard. 5116 Queensberry Ave.



Picture \S1028-145-OB01-P01.jpg

Comments Front of house, 5116 Queensberry Ave.

Obs_ID S1028-145-OB02

Address 5112 Queensberry Ave

Status Private

Source Service Lateral

Location Yard - front

Nearest MH S09QQ1010MH

Comments Smoke from service lateral in front yard. 5112 Queensberry Ave.



Picture \S1028-145-OB02-P01.jpg

Comments Front of house, 5112 Queensberry Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-145	Smoke	11/18/2008	ADS/TM	S09QQ1031MH	Dry	Yes	1,111.81

Obs_ID S1028-145-OB03

Address 5104 Queensberry Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S09QQ1030MH

Comments Smoke from cleanout in front yard. 5104 Queensberry Ave.

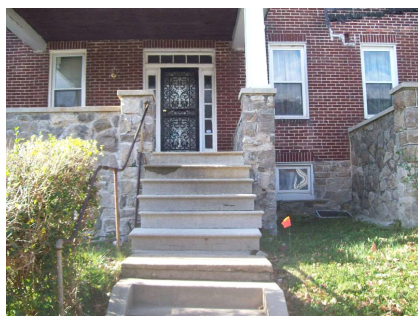

Picture \S1028-145-OB03-P01.jpg

Comments Front of house, 5104 Queensberry Ave.

Obs_ID S1028-145-OB04

Address 5022 Queensberry Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S09QQ1023MH

Comments Smoke from cleanout in front yard. 5022 Queensberry Ave.



Picture \S1028-145-OB04-P01.jpg

Comments Front of house, 5022 Queensberry Ave.

Obs_ID S1028-145-OB05

Address 5020 Queensberry Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S09QQ1023MH

Comments Smoke from cleanout in front yard. 5020 Queensberry Ave.



Picture \S1028-145-OB05-P01.jpg

Comments Front of house, 5020 Queensberry Ave.

Obs_ID S1028-145-OB06

Address 5016 Queensberry Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S09QQ1023MH

Comments Smoke from cleanout in front yard. 5016 Queensberry Ave.

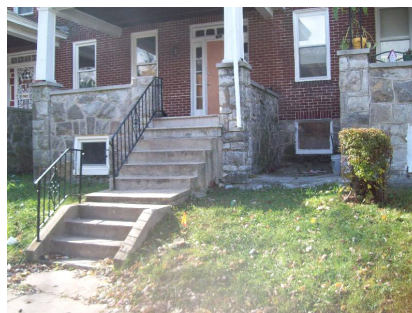

Picture \S1028-145-OB06-P01.jpg

Comments Front of house, 5016 Queensberry Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-145	Smoke	11/18/2008	ADS/TM	S09QQ1031MH	Dry	Yes	1,111.81

Obs_ID S1028-145-OB07

Address 5000 Queensberry Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S11QQ1004MH

Comments Smoke from cleanout in front yard. 5000 Queensberry Ave.



Picture \S1028-145-OB07-P01.jpg

Comments Front of house, 5000 Queensberry Ave.
